

AIT Drive

User's Guide

SDX-700 Series
SDX-710 Series

This document contains proprietary information which is protected by copyright.

All rights reserved. No part of this document may be photocopied, reproduced or translated to another language without prior written consent of Sony.

The information contained in this document is subject to change without notice.

SONY MAKES NO WARRANTY OF ANY KIND WITH REGARD TO THIS DOCUMENT.

Sony shall not be liable for error contained herein, indirect, special, incidental or consequential damages in connection with the furnishing, performance or use of this document.

VORSICHT

Diese Ausrüstung erfüllt die Europäischen EMC-Bestimmungen für die Verwendung in folgender / folgenden Umgebung(en):

- Wohngebieten
- Gewerbegebiete
- Leichtindustrialgebiete

(Diese Ausrüstung erfüllt die Bestimmungen der Norm EN55022, Klasse B.)

사용자 안내문

이 기기는 가정용으로 전자파 적합등록을 한 기기로서 주거지역에서는 물론 모든 지역에서 사용할 수 있습니다.

Contents

Introduction	4
Product Features	4
Precautions	5
Installation	7
SCSI Connection/Setting the SCSI ID (SDX-700C)	7
SCSI Connection/Setting the SCSI ID (SDX-710C)	8
Option Switches (DIP Switch) ..	9
Mounting Holes	10
Remodeling from 5.25" Model to 3.5" Model	13
Orientation	14
Operation	15
Location of 3 LEDs	15
LED Indication for Drive Status	15
Drive Operation	16
Emergency Cassette Removal Procedure	17
Interface Implementation	20
Supported SCSI Messages	20
Supported SCSI Commands	20
Specification	21
Product Specifications	21
Third Party Support Contacts (In the USA)	23
Sony Contacts	25

SDX-700 Tape Drive

The Sony SDX-700 series drive is a high capacity data storage device using Advanced Intelligent tape (AIT) technology. The SDX-700 series drive achieves high data reliability through Read-After-Write, an additional level of Error Correction Code, and other features.

The Sony SDX-700 series drive stores data on tape using a standard format called AIT (Advanced Intelligent Tape) and ALDC formats.

Introduction

Product Features

	SDX-700 series
Data Capacity	100 GByte uncompressed (with AIT-3 230 m tape) 260 GByte compressed * (with AIT-3 230 m tape)
Transfer Rate (sustained)	12 MByte/sec uncompressed 31.2 MByte/sec compressed *

* This is assuming 2.6 : 1 compression ratio.

- Supported Format : AIT-1, AIT-2, AIT-3
- Burst Transfer Rate
 - 12 MBytes/sec Asynchronous
 - 160 MByte/sec Synchronous (SDX-700C)
 - 40 MByte/sec Synchronous (SDX-710C)
- 18 M Byte Buffer Memory
- 3.5" form factor
- Embedded SCSI Interface
 - Ultra 160 Wide LVD/SE SCSI (SDX-700C)
 - Ultra Wide HVD SCSI (SDX-710C)
- Supports Variable or Fixed Record Length
- Supports SCSI Disconnection/Arbitration
- Frame Rewrite Function
- Three levels of Error Correction Code (ECC)
- High Speed search (120 times normal Read/Write speed of AIT-3 mode)
- Random Read, Append Write

Precautions

Installation

Avoid placing the drive in a location subject to:

- high humidity
- high temperature
- mechanical shock and vibration
- direct sunlight

Operation

- Do not move the drive while it is operating. It may cause malfunction.
- Avoid exposing the drive to sudden changes from a low to high in temperature. This may cause water condensation to collect inside the drive. If the ambient temperature should suddenly rise while the drive is turned on, wait at least one hour before turning on the drive. If you attempt to operate the drive immediately after a sudden increase in temperature, a malfunction may occur.
- Turning off the power to the drive while it is writing to tape may cause the tape to become unreadable. All previously negotiated parameters will be lost, whenever power to the drive is cycled.
- Upon execution of the hardware reset hole, the driver will be reset and there is a risk of lost and unreadable data. Thus, please do not use the hole other than repair purposes. (See page 15)

Transportation


- Keep the original packing materials to facilitate transportation of the drive.
- Always remove the tape before moving the drive. After removing the drive from the computer, repack the drive into its original packing.

Notice of SCSI Termination

The SDX-700C and SDX-710C conform to the Microsoft PC97 standard which requires the internal (naked) drive to be terminated with an external terminator.

Microsoft PC97 SCSI requirements

SCSI peripherals must not terminate the bus. Both internal and external cable ends are instead terminated by plug-in connectors.


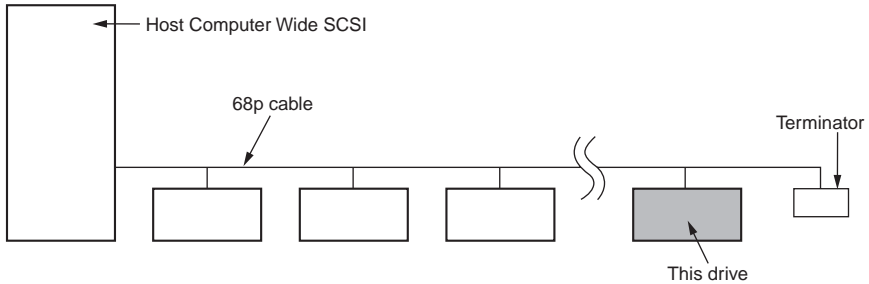


Exapmle of SCSI set-up

Installation

SCSI Connection/Setting the SCSI ID (SDX-700C)

SCSI ID	
SCSI ID	P.D. NC 3 2 1 0
0	
1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	

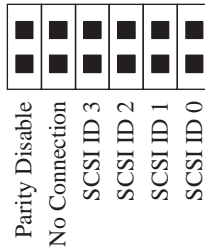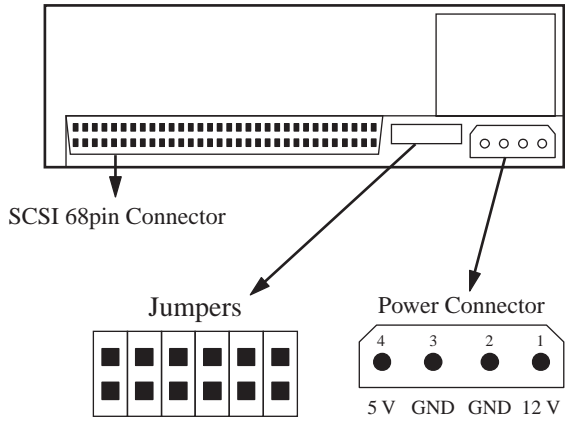

Parity

Disable	
Enable	

- Note :** = CLOSED/Jumper
 = OPEN/Jumper not installed
 Don't care




Parity Disable Jumper

Parity check function can be disabled by Jumper. Parity check is disabled while left end jumper is installed. Parity generate function is always enabled.

SCSI Connection/Setting the SCSI ID (SDX-710C)

SCSI ID

SCSI ID	P.D. N.C.	3	2	1	0
0		■	■	■	■
1		■	■	■	□
2		■	■	■	□
3		■	■	■	□
4		■	■	■	■
5		■	■	■	□
6		■	■	■	□
7		■	■	■	□
8		□	■	■	■
9		□	■	■	□
10		□	■	■	■
11		□	■	■	□
12		□	■	■	■
13		□	■	■	■
14		□	■	■	■
15		□	□	□	□

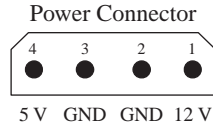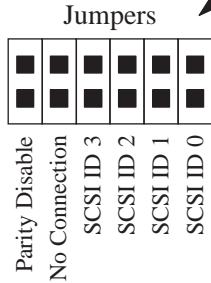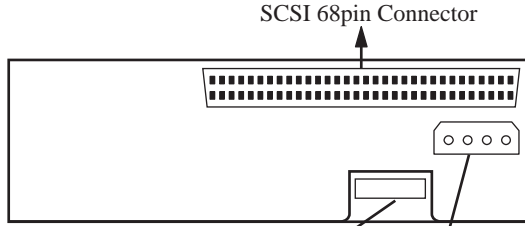

Parity


Disable	□	□	□	□	□
Enable	■	■	□	□	□

- Note :** □ = CLOSED/Jumper
■ = OPEN/Jumper not installed
□ = Don't care


Parity Disable Jumper

Parity check function can be disabled by Jumper. Parity check is disabled while left end jumper is installed. Parity generate function is always enabled.

Option Switches (DIP Switch)

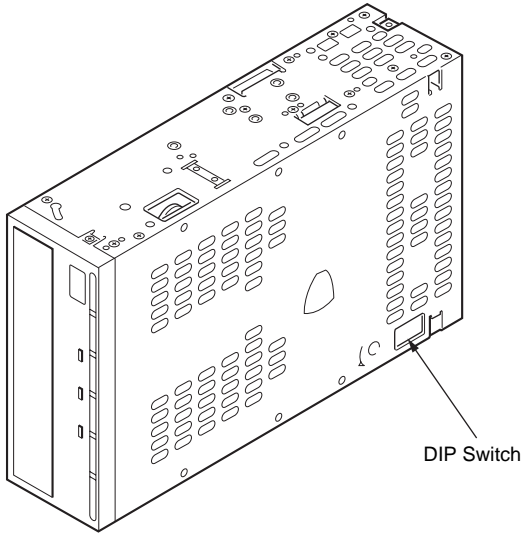

DIP Switch Positions

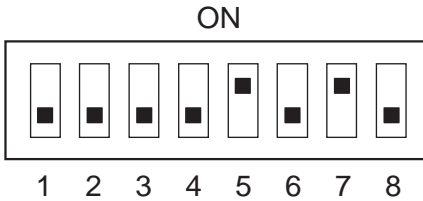


- 1 Reserved (OFF)
- 2 Reserved (OFF)
- 3 Reserved (OFF)
- 4 Reserved (OFF)
- 5 Terminator Power (ON)
- 6 Reserved (OFF)
- 7 DC Control (1) (ON)
- 8 DC Control (2) (OFF)

Data Compression Control DIP switch


Data compression can be selected by DIP switches. Data compression is enabled while position 7 [DC Control (1)] is ON. Control by host can be disabled when position 8 [DC Control (2)] is ON.

Mounting Holes


For 3.5" Standard Height (SDX-700C)

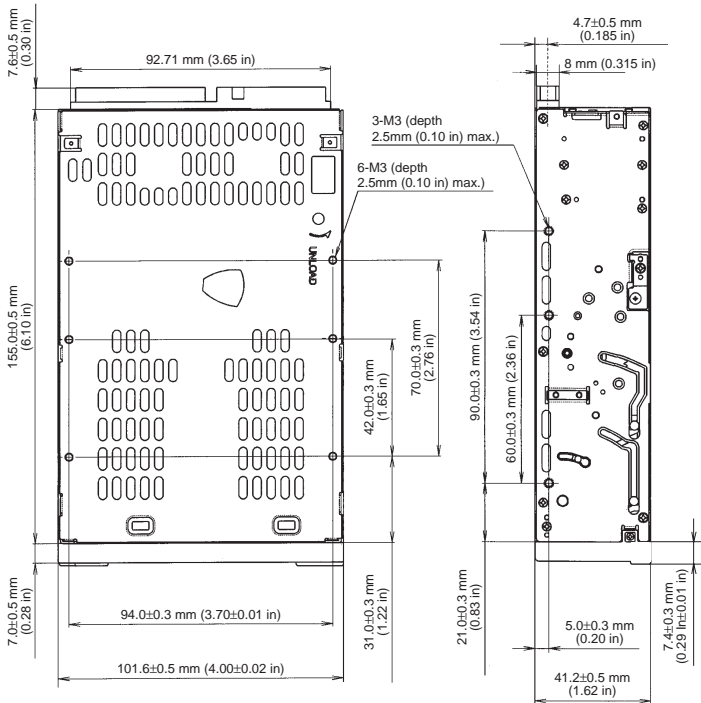

For 3.5" Standard Height (SDX-710C)

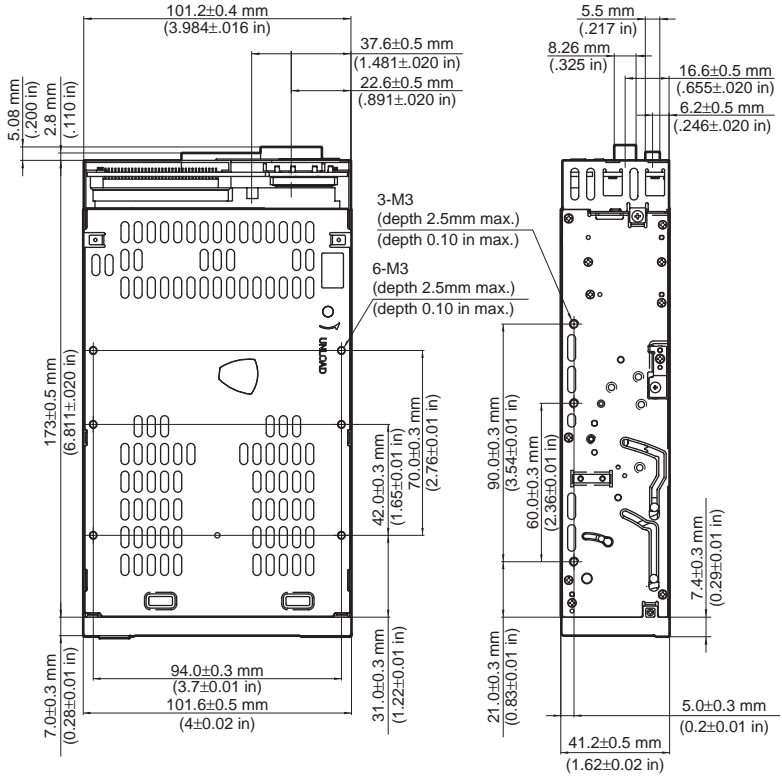

For 5.25" Half Height (SDX-700C/R)

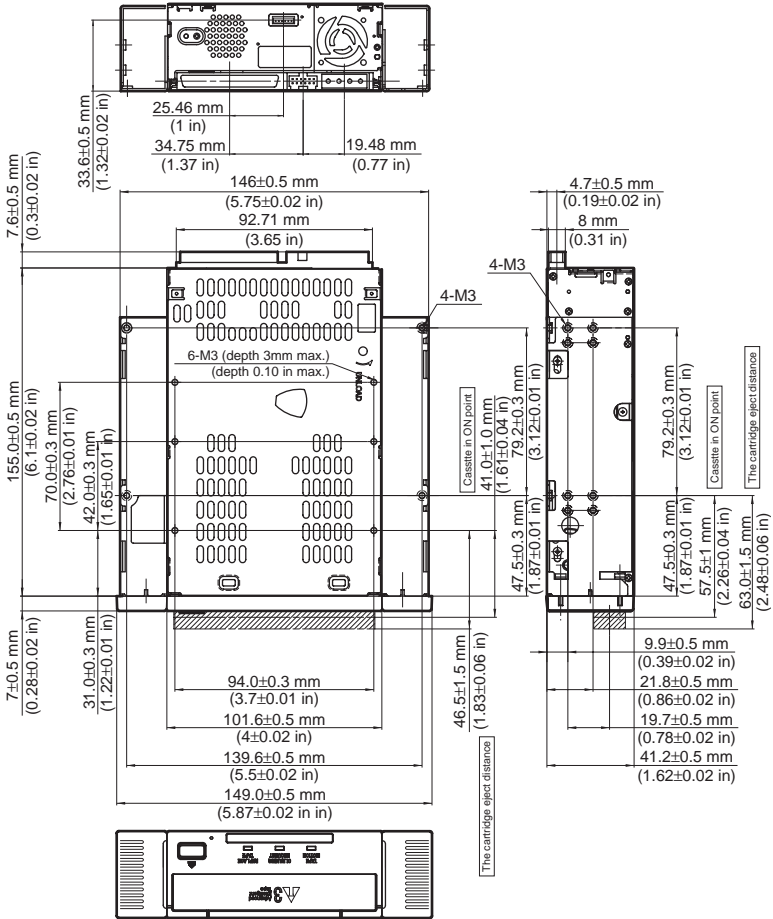


Remodeling from 5.25" Model to 3.5" Model


You can remodel the SDX-700C/R (5.25" model) to the SDX-700C (3.5" model) yourself.

1 Remove the 2 screws for each side rail.

2 Take the side rail off.

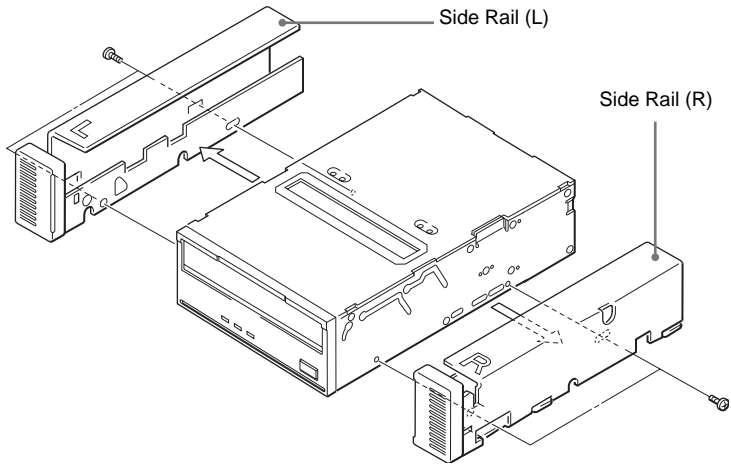

Orientation

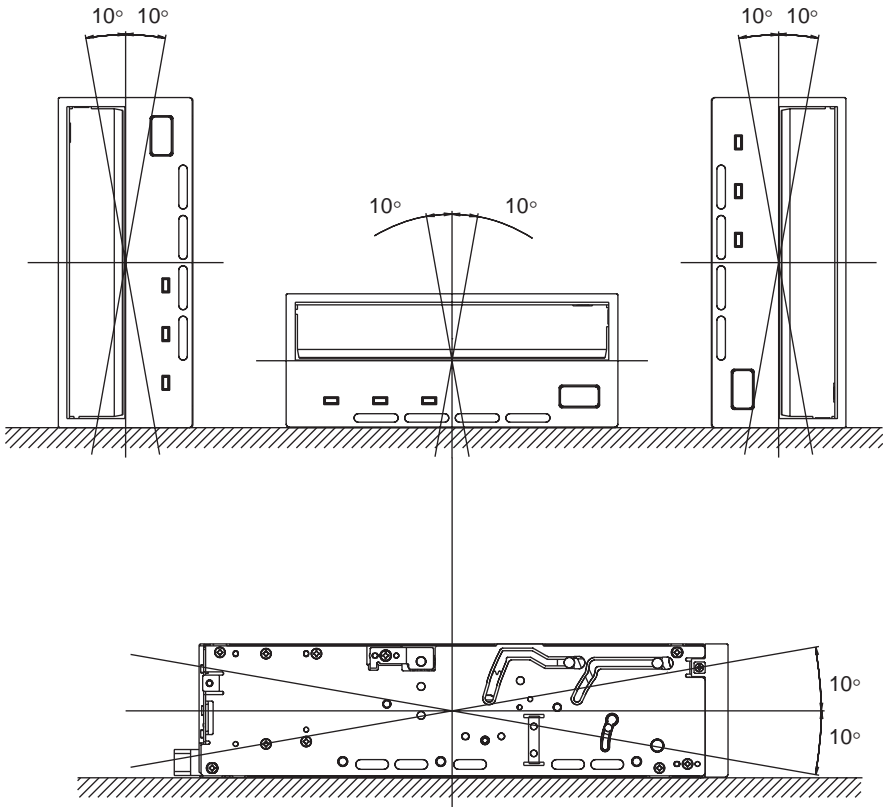


Operation

Location of 3 LEDs

There are three LED indications (Tape Motion, Cleaning Request, Replace Tape) and an EJECT button on the front panel of the unit.

Front Panel (for 3.5" Standard Height)

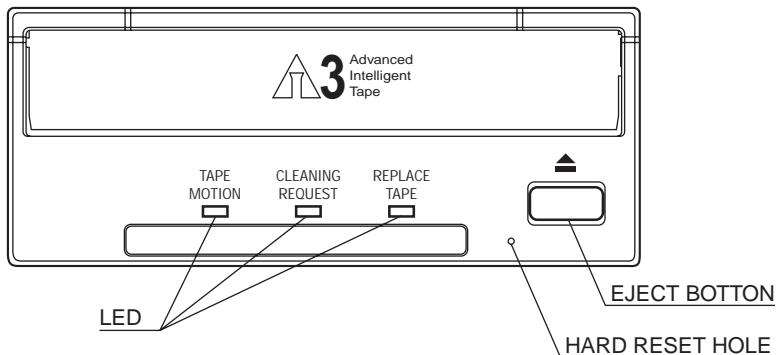

LED Indication for Drive Status

The LED indicators are defined as follows

LED			
Tape Motion	Cleaning Request	Replace Tape	Sense
A	Independent	Independent	Tape Loaded
B	Independent	Independent	Tape Access in Progress (write/read)
C	Independent	Independent	Tape Access in Progress (others)
Independent	A	Independent	Cleaning is requested
Independent	B	Independent	Cleaning is Not Completed
Independent	Independent	A	Media Error Occurred
C	C	C	H/W Error Occurred

A: On

B: Slow (0.9 sec on/0.3 sec off)

C: Fast (0.3 sec on/0.3 sec off)

Drive Operation

Loading a Cassette

Insert a cassette into the slot on the front panel with the arrow on the cassette pointing towards the drive. As the cassette is inserted, the drive takes it and automatically loads it into drive mechanism.


Unloading a Cassette

The cassette can be removed from the SDX-700/SDX-710 either in response to a SCSI Unload Command, or by pressing the eject bottom.

By pressing Eject button, the tape goes to BOT, the drive unthreads it, and ejects the cassette from the slot.

Write-protecting a Cassette

Cassettes can be write-protected by sliding the tab on the back of the cassette. In this state, data can be read from the tape but not written onto it.

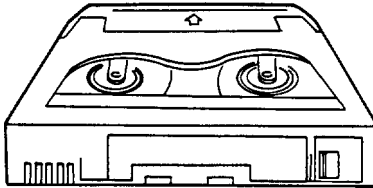

AIT-1 AIT-2, 3



Using your fingernail, push the switch in the direction of the arrow to protect the tape from writing or accidental erasure.



Return the switch to its original position to re-enable writing.

Using a Cleaning Tape


In case of SDX-700 series/SDX-710 series, a cleaning function is built in the drive and hence, a periodic cleaning using cleaning cassette such as other format requires is not necessary. However, when the drive does not recover at the worst case, cleaning cassette is recommended to use.

Emergency Cassette Removal Procedure

In case the tape is stuck inside the drive, you could remove the tape cartridge manually.

- 1** Remove the drive from the chassis or enclosure to allow access to the bottom and right side of the drive.
- 2** Remove the drive's top cover.
- 3** Locate the small opening in the bottom of the drive and insert the tip of a precision screwdriver so that the Threading motor shaft can be rotated.
- 4** Rotate the motor shaft counterclockwise to bring the threading mechanism back to the initial position. (Refer to the photo-1 on page 19.)
- 5** Before manual eject procedure, tape slack must be removed in order to prevent tape damage. Press and rotate the gear mechanism located on the right side of the drive clockwise to tighten the tape.
- 6** After the tape slack has been removed, turn the screw located on the right side of the drive clockwise by a precision screwdriver until the tape cartridge is lifted out of the drive mechanism and is ejected.

7 Return the drive to Sony for repair.

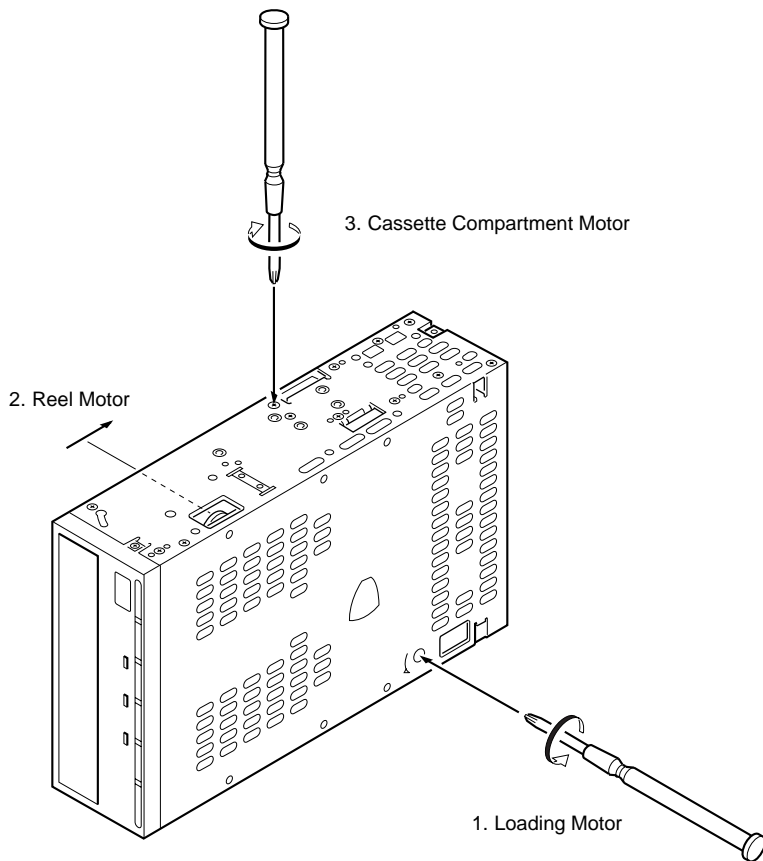

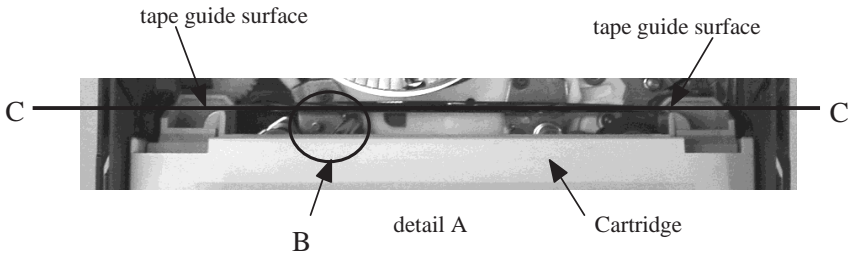
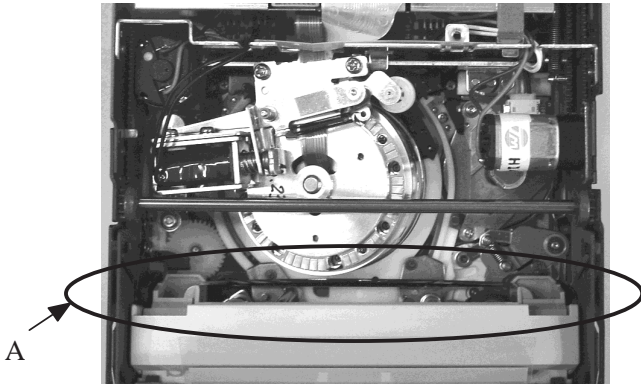


Photo-1: The Initial Position of the Threading Mechanism

Caution

Stop rotating the motor shaft immediately, when the guide B (see detail A of Photo-1) gets to the area below the line C-C (This line is defined by 2 circular tape guide surfaces of the cartridge). Otherwise the gear of the drive can be damaged.

Interface Implementation

Supported SCSI Messages

Abort	Message Parity Error
Bus Device Reset	Message Reject
Command Complete	No Operation
Disconnect	Restore Pointers
Extended Message	Save Data Pointer
– Synchronous Data Transfer Request	
– Wide Data Transfer Request	
Identify (w/&w/o Disconnect)	
Ignore Wide Residue	

Supported SCSI Commands

Erase	Report Luns
Inquiry	Request Block Address
Load/Unload	Request Sense
Locate	Reserve Unit
Log Sense	Rewind
Log Select	Seek Block
Mode Select	Send Diagnostic
Mode Sense	Space
Prevent Allow Medium Removal	Test Unit Ready
Read	Verify
Read Block Limits	Write
Read Buffer	Write Buffer
Read Position	Write Filemarks
Receive Diagnostic Result	
Release Unit	
Report Density Support	

Specification

Product Specifications

Dimensions

	SDX-700C	SDX-710C	SDX-700C/R
Height	41.2 mm (1.62 in)	41.2 mm (1.62 in)	41.2 mm (1.62 in)
Width	101.6 mm (4.0 in)	101.6 mm (4.0 in)	146 mm (5.75 in)
Depth	155.0 mm (6.1 in)	173.0 mm (6.8 in)	155 mm (6.1 in)

Altitude

Operating	0 to 10,000 feet
-----------	------------------

Vibration

Operating	Swept Sine 5 to 500 Hz *0.25 G Peak 1 Octave/min.
Non-Operating	Swept Sine 5 to 500 Hz *0.5 G Peak 1 Octave/min. 3 axes, 3 directions

Acoustic Noise

(A) curve weight

Streaming Write/Read	35 db (A)
Insert/Eject	60 db (A)

Note

The sound-meter on (A) scale is located 1m in front of the center of the drive front panel.

Shock

Operating	No Data Loss Half Sine Performance 5 G Peak 3 ms 3 axes, 3 directions *Interval 10 seconds
Non-Operating	No Device Damage Half Sine 90 G Peak 3 ms (30 G Peak 11 ms) 3 axes, 3 directions

Temperature and Humidity Range

Temperature

Operating	5 °C to 40 °C ($\Delta T < 10$ °C/h)
Non-Operating (mech.)	- 40 °C to 70 °C ($\Delta T < 20$ °C/h)
Non-Operating (tape)	- 40 °C to 45 °C ($\Delta T < 20$ °C/h)

Humidity

Operating	20 to 80% RH, non-condensing Maximum wet bulb temperature = 26 °C
Non-Operating (mech.)	5 to 95% RH ($\Delta T < 30\%/h$)
Non-Operating (tape)	20 to 80% RH ($\Delta T < 30\%/h$)

Power Requirements

Model	Voltage	Max Ripple	Current	
			Typical	Maximum
SDX-700 series	5 V +/- 5 %	100 mVp-p	2.5 A	2.9 A
	12 V +/- 10 %	150 mVp-p	0.4 A	2.0 A
SDX-710 series	5 V +/- 5 %	100 mVp-p	2.9 A	3.7 A
	12 V +/- 10 %	150 mVp-p	0.4 A	2.0 A

Suspended Particulate

Operating	Less than 150 microgram/m ³ Based Sampling period 24 hours
-----------	--

ESD

Discharge	< 15 kV: No operation failure
Voltage	< 20 kV: No drive damage

Air-cooling Requirement

Surrounding temperature	< 40 °C
-------------------------	---------

Clean air flow is recommended to minimize the possibility of data loss.

Third Party Support Contacts (In the USA)

Host Adapter Vendors	Phone Numbers
Adaptec	408-945-8600
ATTO	716-691-1999
Bus Logic	408-492-9090
DPT	407-830-5522
Future Domain	714-253-0400
Initio	408-988-1919
Qlogic	714-438-2200
Ultra Systems Inc.	714-367-8800

Operating Systems	Backup Software Vendors	Phone Numbers
DOS	Arcada	407-333-7500
	Cheyenne	516-484-5110
	Columbia Data Products	407-869-6700
	Corel	613-728-8200
	NovaStor	805-579-6700
	Palindrome	708-505-3300
	ST. Bernard Software	619-676-2277
	Sytron	508-898-0100
Macintosh	Tapedisk	715-235-3388
	Cheyenne	516-484-5110
	Corel	613-728-8200
	Dantz	510-253-3000
OS/2	NovaStor	805-579-6700
	Cheyenne	516-484-5110
	Corel	613-728-8200
	IBM	800-426-3333
	NovaStor	805-579-6700
Windows	Sytron	407-333-7500
	Arcada	407-333-7500
	Cheyenne	516-484-5110
	Corel	613-728-8200
	Creat	909-595-8811
	NovaStor	805-579-6700
	ST. Bernard Software	619-676-2277
Windows NT	Sytron	508-898-0100
	Arcada	407-333-7500
	Cheyenne	516-484-5110
	Creat	909-595-8811
	Microsoft	206-882-8080
	NovaStor	805-579-6700
Windows NT Advanced Server	Avail Systems	303-444-4018
	Microsoft	206-882-8080

* All phone numbers listed are in the USA.

Add the country code (1) prior to those numbers when calling from outside the USA.

Operating Systems	Backup Software Vendors	Phone Numbers
Windows 95	NovaStor	805-579-6700
DEC Unix	Cheyenne	516-484-5110
	NovaStor	612-933-8790
	Software Moguls	612-933-8790
	Work Station Solutions	603-880-0080
SUN Unix	Legato	415-812-6000
	NovaStor	818-707-9900
	Software Moguls	612-933-8790
	Sun Soft	310-348-8649
	Work Station Solutions	603-880-0080
Solaris Unix	Cheyenne	516-484-3150
	Legato	415-812-6000
	NovaStor	818-707-9900
	Software Moguls	612-933-8790
	Sun Soft	310-348-8649
	Work Station Solutions	603-880-0080
SCO Unix	Cheyenne	516-484-3150
	Legato	415-812-6000
	Software Moguls	612-933-8790
	Work Station Solutions	603-880-0080
NCR Unix	NovaStor	818-707-9900
	Work Station Solutions	603-880-0080
HP Unix	Cheyenne	516-484-3150
	NovaStor	818-707-9900
	Work Station Solutions	603-880-0080
AIX Unix	Cheyenne	516-484-3150
	Legato	415-812-6000
	NovaStor	818-707-9900
	Software Moguls	612-933-8790
	Work Station Solutions	603-880-0080
Interactive Unix	Sun Soft	310-348-8649
SGI Unix	Software Moguls	612-933-8790
	Work Station Solutions	603-880-0080
Novell UNIXware	Novell	801-263-3500
Novell NLM	Arcada	407-263-3500
	Avail Systems	303-444-4018
	Cheyenne	516-484-3150
	Columbia Data Products	407-682-0265
	Creata	909-595-8811
	Legato	415-812-6000
	NovaStor	818-707-9900
	Novell	801-419-5544
	Palindrome	708-505-3300
	Performance Tech	210-979-2110
	ST. Bernard Software	619-676-2277
	Symantec	310-449-4156
	Sytron	508-898-0100
Banyan	Performance Tech	210-979-2110
Lantastic	NovaStor	818-707-9900
Amiga	Moonlighter	407-384-9484
RS6000	Legato	415-812-6000
	NovaStor	818-707-9900
	Software Moguls	612-933-8790

Sony Contacts

For further information, please contact:

Sony Electronics Inc., Technical Support

3300 Zanker Road San Jose, CA95134, 1940. USA

TEL: (1) 800-352-7669

Sony Corporation

Electronic Devices Marketing Group, Product Marketing Div.

Computer Peripherals Dept. Tape Streamer Section

Osaki Gate City East Tower, 1-11-1, Osaki

Shinagawa-ku, Tokyo, 141-0032 Japan

TEL: (81) 3-5435-3486 FAX: (81) 3-5435-3565

Sony of Canada Ltd., AV/IT Marketing Group

Computer Peripherals Product Marketing

115 Gordon Baker Road Toronto, Ontario, M2H 3R6 Canada

TEL: (416) 499-1414 or (1) 800-961-7669

FAX: (416) 499-8541

Sony Computer Peripherals & Components Europe

URL: <http://www.sonyisstorage.com/>

Electronics Devices Marketing (Singapore)

(A division company of Sony Electronics (S) Pte. Ltd.)

Enterprise Storage Solutions Dept.

2 International Business Park, #01-10 Tower One,

The Strategy, Singapore 609930

TEL:65-6544-8000 FAX:65-6544-7390

Sony Corporation of Hong Kong Ltd.

Computer Peripheral Sales & Marketing Division

Electronic Devices Marketing Hong Kong

45/F, The Lee Gardens, 33 Hysan Avenue, Causeway Bay, Hong Kong

TEL: (852) 2909-1008 FAX: (852) 2909-2001

Sony Corporation of Hong Kong Ltd. Beijing Rep. Office

Computer Peripheral Div.

Full Link Plaza Tower A 11/F., No.18 Chaoyangmenwai Ave., Beijing
100020 P.R.C.

TEL:86-10-6588-0558 FAX:86-10-6588-0855

URL: <http://www.sony.com.cn>

Sony Corporation of Hong Kong Ltd. Shanghai Rep. Office

44F., HSBC Tower, 101 Yin Cheng East Road, Pudong, New Area,
Shanghai, P.R.C. Postcode 200120

TEL: 86-21-6841-3222 FAX: 86-21-6841-0280

Sony Comércio e Indústria Ltda.

Rua Inocêncio Tobias, 125-Parte-Parque Industrial Thomas Edson-Barra
Fund, CEP01144-000, São Paulo -SP-Brasil

TEL: (55) 11-3824-6586 to 6598 FAX: (55) 11-3611-9064

URL: <http://www.sonybrasil.com>

Sony Australia Ltd., Information Technology Products Division

P.O. Box 377, NSW 1670, Australia

TEL: 1800-226-429 FAX: (61) 2-9870-8564 A.C.N. 001 215 354

URL: <http://www.sony.com.au/home.asp>

E-mail: informatica@ssp.br.sony.com

Sony Chile Ltda

Av. Kennedy 8017, Las Condes, Santiago, Chile

TEL: (02) 210-6000 FAX: (02) 210-5417

Sony Taiwan Limited

Computer Peripheral Dept. Electronic Devices Marketing Taiwan Company

Rm 1506, Top FL., Chia Hsin Bldg. No.96, Sec.2, Chung Shan N. Rd.,
Taipei, Taiwan

TEL: 886-2-2522-3286 FAX: 886-2-2562-4587

Sony Korea Corporation EDMK CP Sales & Marketing Team

34F, ASEM Tower, World Trade Center, 159-1, Samsung-Dong,
Kangnam-Ku, Seoul, 135-798, Korea

TEL: 82-2-6001-4249 FAX: 82-2-6001-4115

URL: <http://www.sony.co.kr/cp/>

Sony Gulf FZE Computer Display & Peripheral Div.

P.O.BOX 16871, Jebel Ali, Dubai, U.A.E.

TEL: 971-4-8815488 or 8816912 FAX: 971-4-8817210 or 8816259

<http://www.sony.net/>

Printed on recycled paper

Printed in Japan